
IZSUŠEVANJE IN MERITVE VLAGE V STANOVNJSKO POSLOVNIH OBJEKTIH

KOŽAR D.O.O.

Sela pri Jugorju 3
8331 Suhor

GSM: 040 300 120
tel.: 07 305 034
faks: 07 305 030
kozar.doo1@siol.net
www.kozar.si


TERMORIZIJSKI POSNETKI

Pri termovizijskem pregledu je bilo ugotovljeno:

1. V vogalih dnevne sobe prihaja do enormne podhlajenosti površin zaradi pomanjkanja izolacije in samega stika betonskih površin. (ploščice in protipožarnega stebra)
Rešitev problema je v izvrtanju lukenj v fuge fasadne opeke in z vbrizgavanjem purpenske mase v zračni prostor med zidom in fasadno opeko. Purpenska masa naj bo nizke ekspanzivnosti.
2. Zaradi oslABLJENE izolacije je potrebno ob oknih odstraniti okrasne letve in dodati purpensko maso. Nato pa ponovno montirati odstranjene okrasne letve in vse spoje obdelati z belim silikonom.

Poročilo pripravil:
Franc Kožar

Direktor:
Franc Kožar

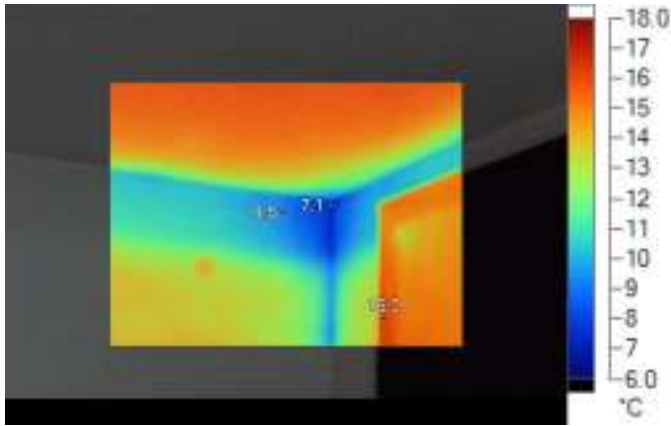

Visible Light Image

IR000323.IS2
2/2/2011 8:41:16 AM

Image Info

Background temperature	22.0°C
Average Temperature	13.2°C
Image Range	7.1°C to 16.2°C
Image Time	2/2/2011 8:41:16 AM




Visible Light Image

IR000324.IS2
2/2/2011 8:41:35 AM

Image Info

Background temperature	22.0°C
Average Temperature	12.5°C
Image Range	7.9°C to 17.1°C
Image Time	2/2/2011 8:41:35 AM

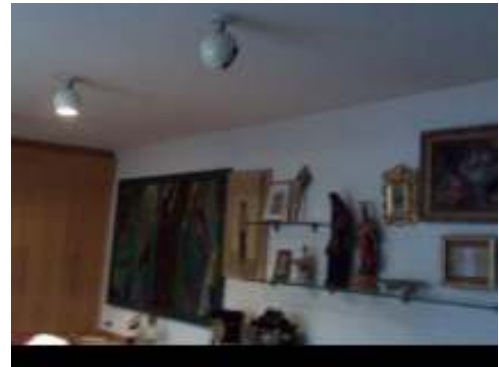



Visible Light Image

IR000325.IS2

2/2/2011 8:41:54 AM

Image Info

Background temperature	22.0°C
Average Temperature	15.2°C
Image Range	11.1°C to 19.1°C
Image Time	2/2/2011 8:41:54 AM

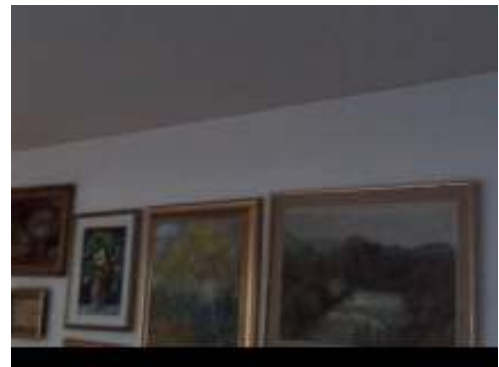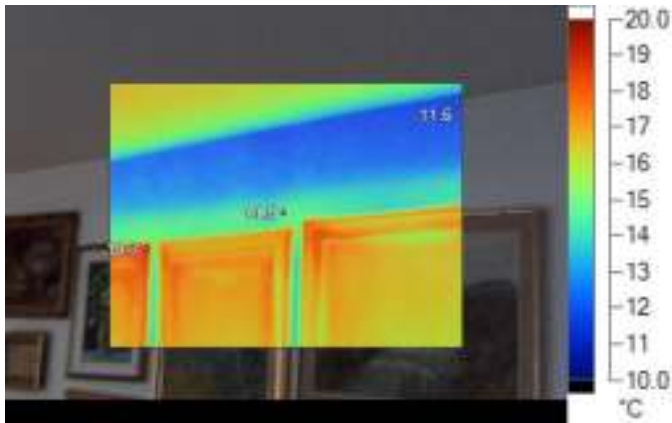

Visible Light Image

IR000326.IS2

2/2/2011 8:42:11 AM

Image Info

Background temperature	22.0°C
Average Temperature	15.1°C
Image Range	11.6°C to 18.7°C
Image Time	2/2/2011 8:42:11 AM



Visible Light Image

IR000327.IS2

2/2/2011 8:42:37 AM

Image Info

Background temperature	22.0°C
Average Temperature	16.5°C
Image Range	11.3°C to 20.6°C
Image Time	2/2/2011 8:42:37 AM





Visible Light Image

IR000328.IS2

2/2/2011 8:43:28 AM

Image Info

Background temperature	22.0°C
Average Temperature	14.0°C
Image Range	8.6°C to 17.4°C
Image Time	2/2/2011 8:43:28 AM

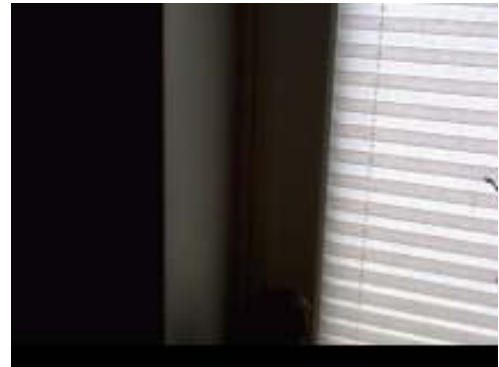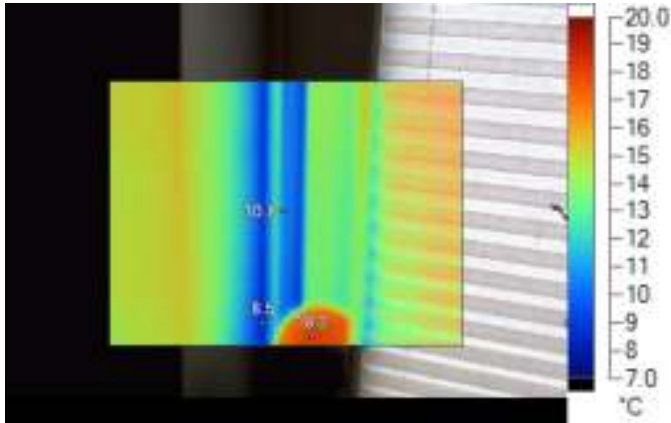


Visible Light Image

IR000329.IS2

2/2/2011 8:43:40 AM

Image Info

Background temperature	22.0°C
Average Temperature	13.9°C
Image Range	8.5°C to 18.2°C
Image Time	2/2/2011 8:43:40 AM

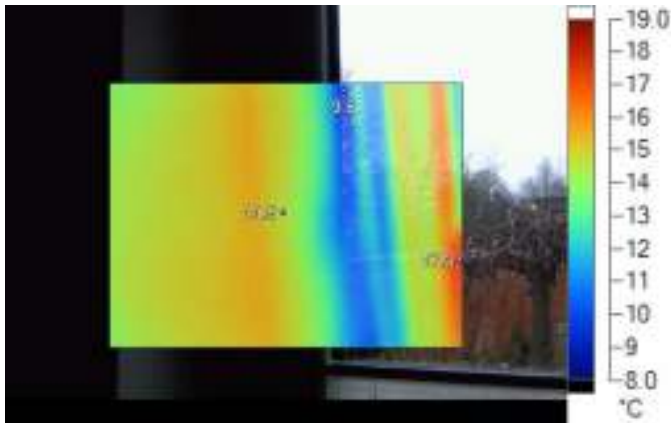

Visible Light Image

IR000330.IS2

2/2/2011 8:44:13 AM

Image Info

Background temperature	22.0°C
Average Temperature	14.1°C
Image Range	9.8°C to 17.3°C
Image Time	2/2/2011 8:44:13 AM




Visible Light Image

IR000331.IS2

2/2/2011 8:44:39 AM

Image Info

Background temperature	22.0°C
Average Temperature	14.3°C
Image Range	6.1°C to 20.5°C
Image Time	2/2/2011 8:44:39 AM

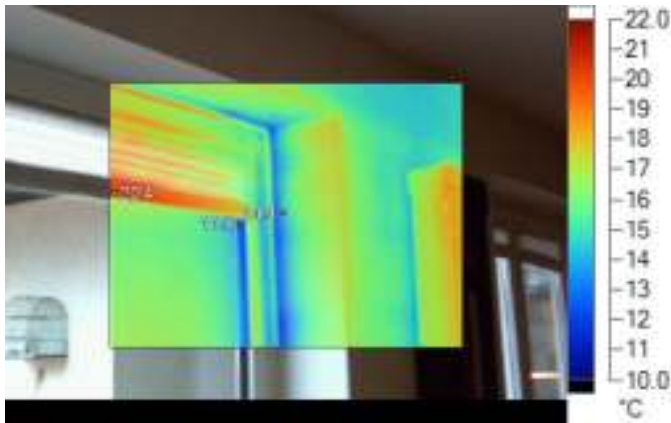


Visible Light Image

IR000332.IS2

2/2/2011 8:45:00 AM

Image Info

Background temperature	22.0°C
Average Temperature	16.1°C
Image Range	11.8°C to 20.4°C
Image Time	2/2/2011 8:45:00 AM

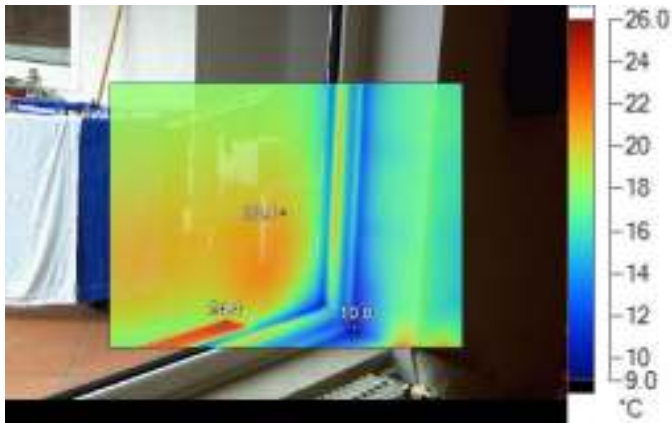

Visible Light Image

IR000333.IS2

2/2/2011 8:45:13 AM

Image Info

Background temperature	22.0°C
Average Temperature	17.9°C
Image Range	10.0°C to 24.4°C
Image Time	2/2/2011 8:45:13 AM



Visible Light Image

IR000334.IS2

2/2/2011 9:06:25 AM

Image Info

Background temperature	22.0°C
Average Temperature	-5.7°C
Image Range	-9.6°C to 0.1°C
Image Time	2/2/2011 9:06:25 AM




Visible Light Image

IR000335.IS2

2/2/2011 9:07:19 AM

Image Info

Background temperature	22.0°C
Average Temperature	-2.9°C
Image Range	-7.8°C to 1.6°C
Image Time	2/2/2011 9:07:19 AM

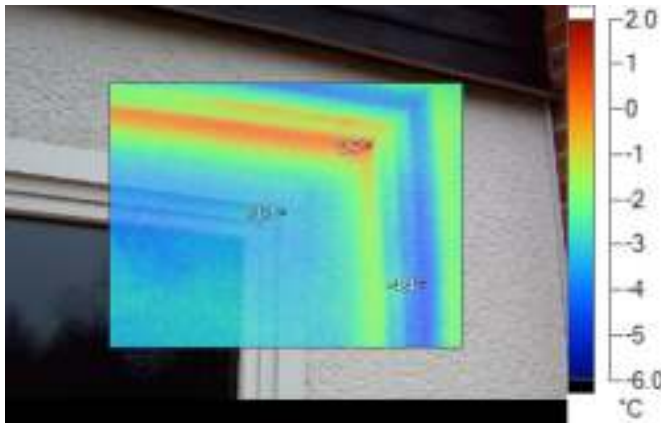

Visible Light Image

IR000336.IS2

2/2/2011 9:08:22 AM

Image Info

Background temperature	22.0°C
Average Temperature	-2.6°C
Image Range	-4.4°C to 0.7°C
Image Time	2/2/2011 9:08:22 AM